

# Rustic Industrial Shelf

#### Difficulty Advanced

The perfect rustic industrial shelf or side board for any room in your home.

There are numerous steps, tools, and evenings involved in this build, but the end result is worth it! We are in LOVE with our new shelf - for a fraction of what it would cost in stores!



Page 1 of 31







Page 2 of 31



### Tools

#### Kreg Tools



#### Other Tools

Miter Saw

Square

Table Saw

Tape Measure

Clamps

Drill (cordless)

Drill Press

Hammer

Impact Driver

Sander

Sawhorse

Drill Press

Grinder

Mig Welder

### Materials

#### Wood Products

1 See Plans , See Plans , See Plans

#### Hardware & Supplies

1 See Attached Plans

Page 3 of 31



## Cut List & Parts

1 See Attached Plans , See Plans

Page 4 of 31



## Directions

## 1

### **Cut Wood Materials**

Cut wood materials as per attached plans (T1-T6, M1, B1 and B2x6).



Page 5 of 31



### Assemble Top Frame

2

Assemble T1-4 into a frame using pocket joints. Attach to T5 (top board).



Page 6 of 31



### Layout and Drill Holes for M1 & B1

3

Layout and drill holes for the steel pipe legs as shown in plans. [Note: Photo shows M1 and B1 stained, but they would not be stained at this point]

Page 7 of 31





Page 8 of 31



### Layout and Drill Holes for Top

4

Using MI as a template, mark out holes and drill them onto the frame attached to T5 as per attached plans.



Page 9 of 31



### 5

### Attach Moulding to Top

Glue and attach moulding in place along frame on T5.



Page 10 of 31



### Attach Feet to Bottom

6

Attach B2 x 6 to B1 (bottom board) according to plans attached. Feet are centred over pipe holes.




Page 11 of 31



### **Drill Assembly Holes**

7

Drill holes in back face of T5 and the front and back face of M1 and B1. Start with an 1/8" diameter hole, followed by a 3/8" hole using a fostner hole 3/8" countersunk. This is to allow us to drill and attach the pipes later on.

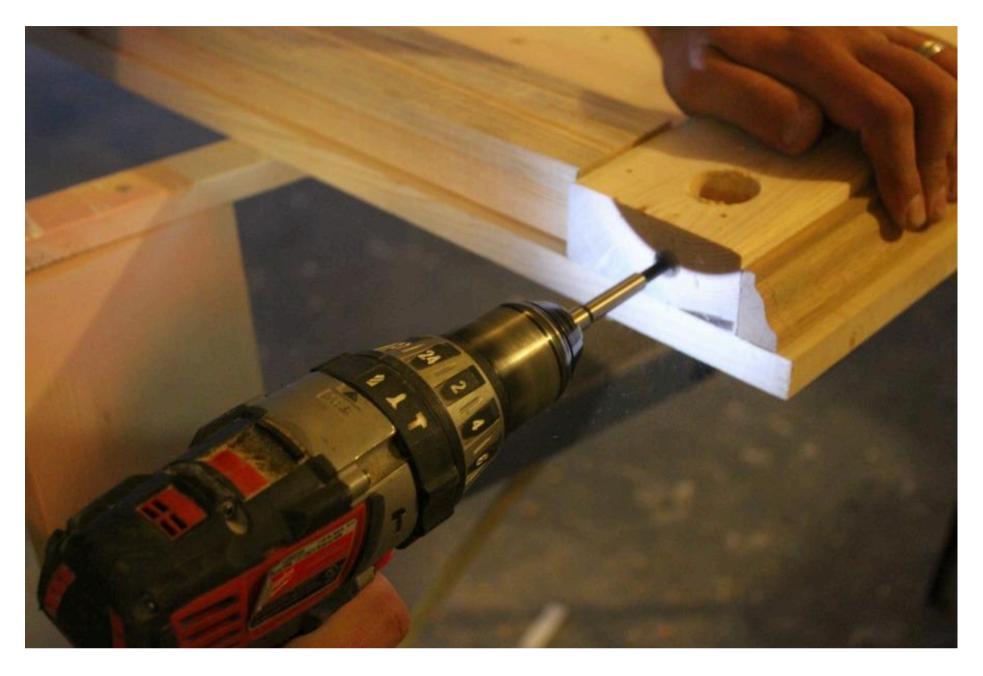

Page 12 of 31



### 8 Dri

### Drill Assembly Holes (T5)

Drill holes into the inside faces of the frame (T4 and T2). You will have to drill at an angle for access.



Page 13 of 31





### **Cut Plugs**

Cut 15 plugs (3/8" diameter) to fill the assembly holes.

Page 14 of 31






Page 15 of 31





### **Cut Steel**

Cut steel as detailed in the plans using a grinder and cutting disc.

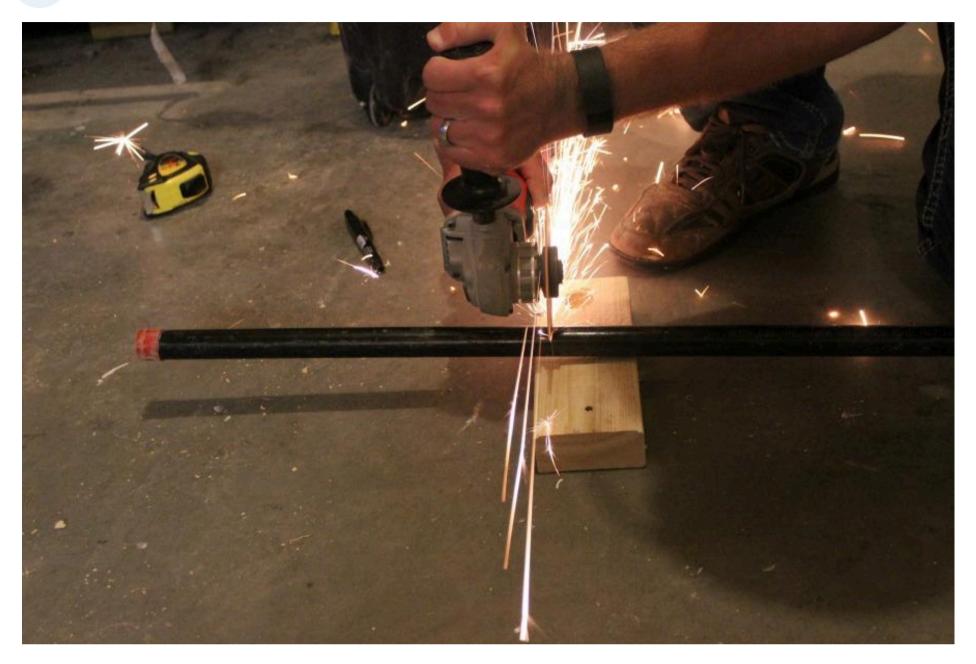

Page 16 of 31




### Mock Up Table

11

Place T5 assembly face down (so that you can access the holes). Put the six steel legs in place. Drill 1/8" diameter holes into pipe at the four locations specified in the plans (three back pipes, and front centre pipe). Once drilled use the #10 screws to attach the legs.

When drilling into pipe, go slow and take your time. It is very easy to break a drill bit on steel.

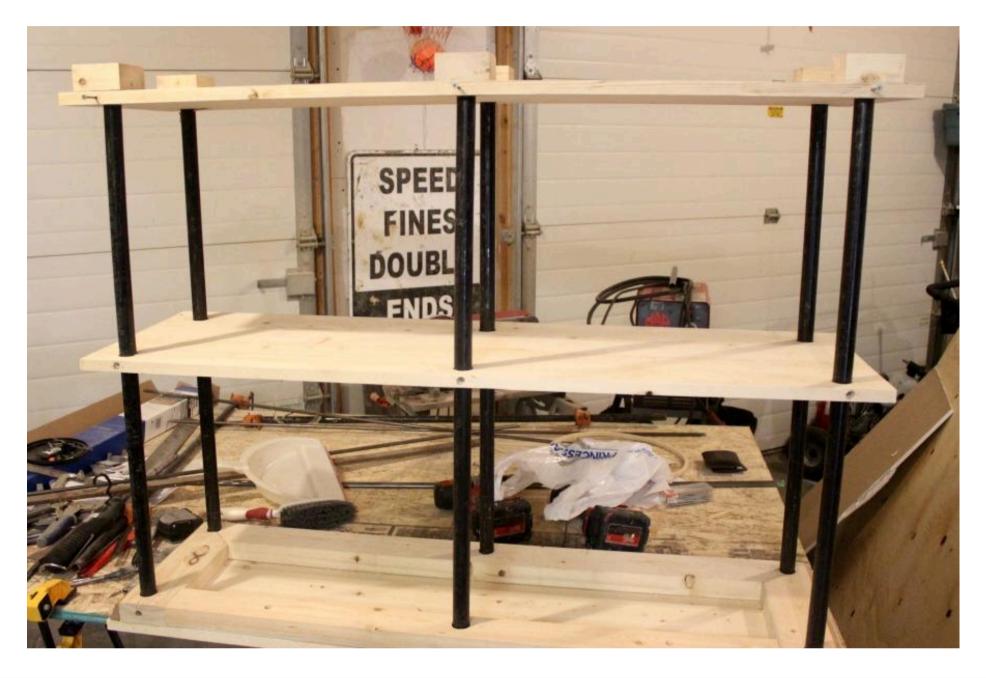

Page 17 of 31



### Mock Up Table (part 2)


12

Place M1 as per the plans (you'll have to use clamps or temporary blocking to hold it in place. Ensure M1 is square to T5, and then drill 1/8" holes into pipe at the six locations specified in the plans, using your previously drilled holes as a guide. Once drilled use the #8 screws to attach the legs.

Place BI as per the plans (you'll have to use clamps or temporary blocking to hold it in place. Ensure BI is square to T5 and MI, and then drill 1/8" holes into pipe at the six locations specified in the plans, using your previously drilled holes as a guide. Once drilled use the #8 screws to attach the legs.

Page 18 of 31



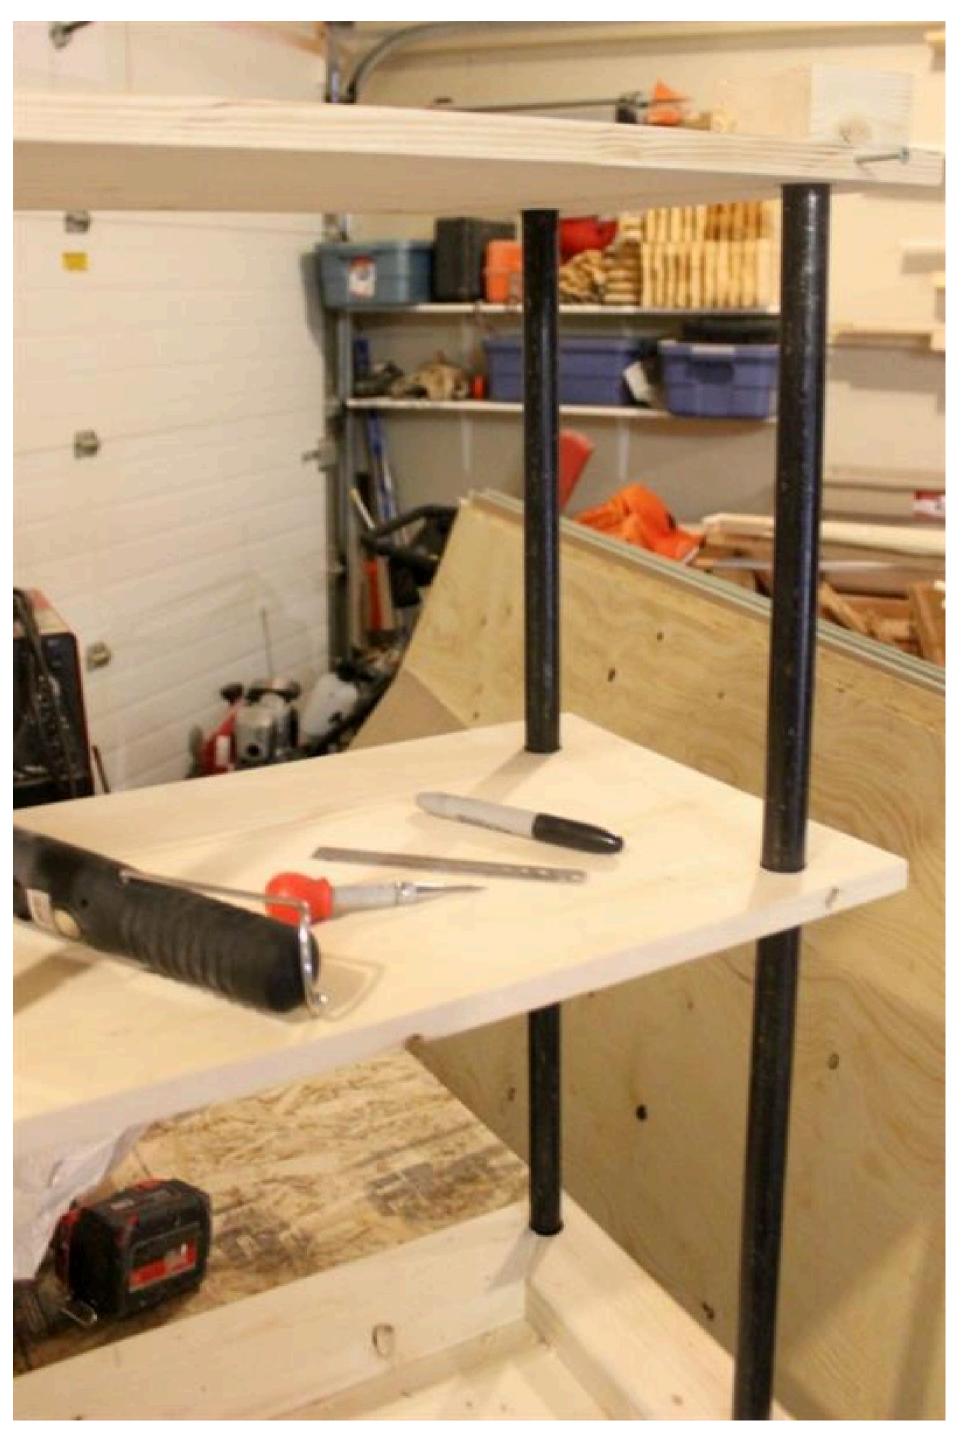

Page 19 of 31



### Drill Holes in Legs for "X" Pipe

Using your measuring tape, mark out the location of the holes for the "X"s (3/8" diameter rods), using a centre punch. They are roughly an 1/8" to 1/4" from the faces of the shelf boards.

For legs L1 and L2 you will have 4 holes for the "X"s on the side profile.

For L4 and L5 you will have 6 holes for the "X"s - 4 for the side profile, and 2 for the back profile.

For L6 you will have 4 holes near the centreline for the back profile.

To drill the holes, start with 1/8" and work your way up to a 7/16" diameter drill bit.

See plans for clarification.

13

Page 20 of 31





Page 21 of 31



### **Notch Holes**

14

In order to install the rod at an angle, you need to open up the hole at an angle. To do this, take your drill and move it upwards and downwards (in the vertical). CAUTION: Take your time, as the drill bit can kick back.



Page 22 of 31




### **Reassemble for "X" Fitting**

Reassemble the shelf. Put R4 and R5 in place - you may have to cut down some rods in order to make them fit. We started with T5 and M1 in place, and fit the top rods first, then added B1 and fit the bottom rods.

Once the rods are in place, use a permanent marker to mark the overlap on the pipe.

To complete the back "X", install R3 first, then pace R1, and R2. Again, some adjustments in length may be needed.

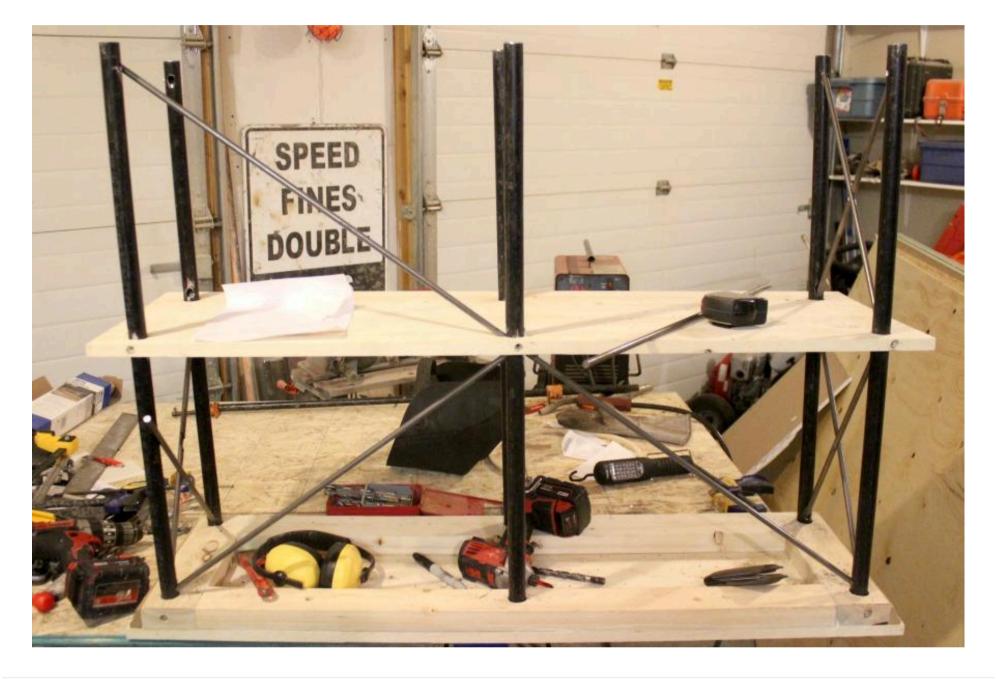

15


Page 23 of 31



### Notch Steel Rods

16

Remove R4 and R5s, making sure to mark the location of each piece for reassembly later. With a grinder, grind out the overlapping space that you previously marked (approximately 1/2 the diameter of the rod should be removed).

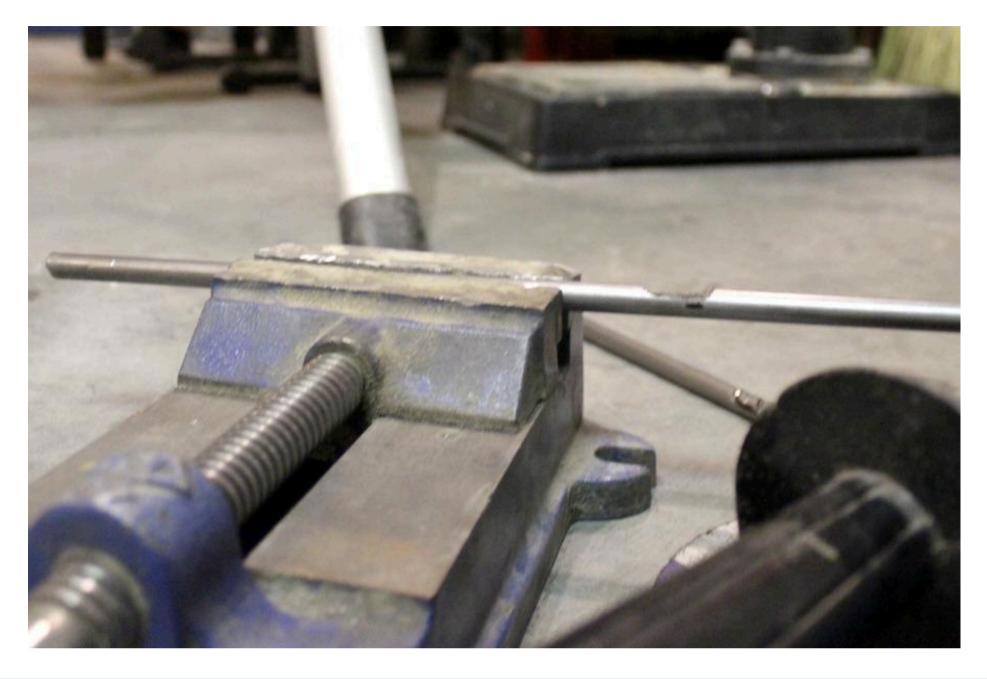


Page 24 of 31



### Reassemble "X"s

17

Reassemble "X"s and check that shelf is square (sides and back).

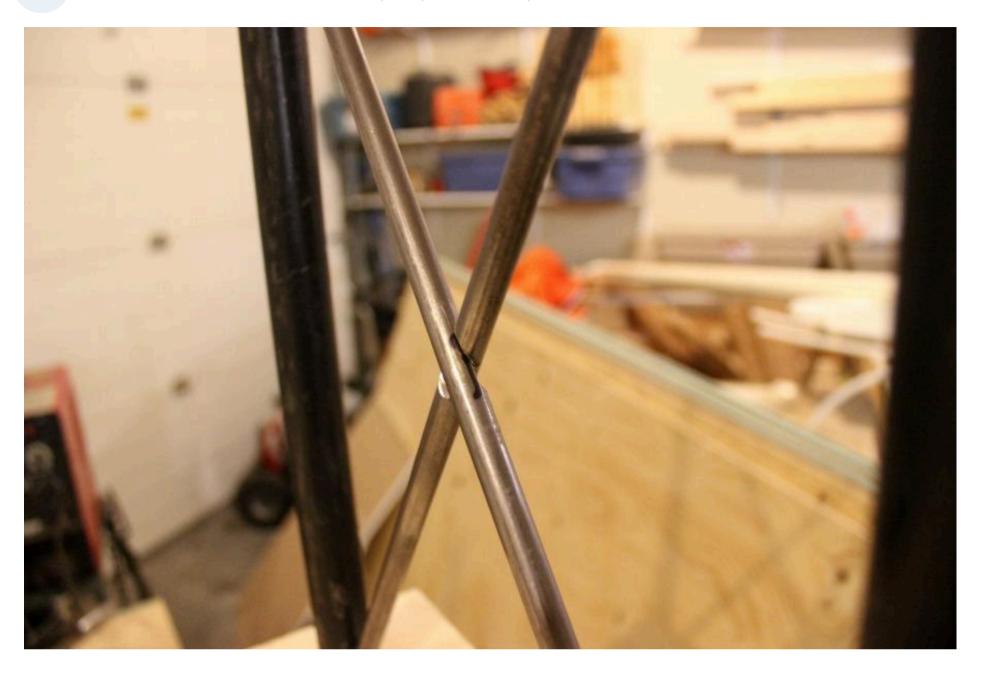

Page 25 of 31



### 18 Stain and Varnish Wood Stain wood in the colour of your of

Stain wood in the colour of your choice and varnish. We took the shelf apart again to ensure because we thought it was easier to get a nice finish when it was disassembled. Don't forget to stain and varnish plugs as well.

Wipe all steel elements with Acetone.

Page 26 of 31





Page 27 of 31



### **Final Assembly**

19

Start with T5. Place PL-300 in holes, place legs and screw and assemble.

Install R4 and R5 rods between T5 and M1. Place and screw M1 in place.

Install R4 and R5 rods between M1 and B1. Place PL-300 in holes, place and screw B1 in place.

Install R1, R2, and R3.

Place and glue wood plugs in place.

Page 28 of 31





Page 29 of 31



### 20

### Weld

Check for square. Clamp as required. Weld steel bars together at all intersections.

Try to protect the wood as best you can with a welding blanket.

Note: if welding causes damage to wood finish, you can lightly sand and refinish as required if necessary.



Page 30 of 31





### **Paint Steel**

Prep steel by grinding down and cleaning welds. Wipe all steel with acetone again and tape of all wood faces. Spray paint all steel.



Page 31 of 31